



SERVICE BULLETIN

---

**BULLETIN NUMBER:** 2025-1

**DATE:** December 15, 2025

**SUBJECT:** Nuisance tripping of 10A TCI fuse

**MODELS AFFECTED:** 5.0 / 4.2 MCGA and MCGB  
7.5 / 6.2 MCGA and MCGB  
9.5 / 7.6 MCGA and MCGB

---

There have been reports from the field of nuisance blowing of the 10A TCI fuse on the above-mentioned MCGA and MCGB generator models. Most units work fine with the original 10A fuse however some units may experience a blown fuse at startup. The result is a crank but no-start condition.

Westerbeke has approved the use of a 15A fuse part number 058597 in place of the 10A TCI fuse on any 5.0 / 7.5 / 9.5 MCGA and MCGB unit in the field.

Note: Westerbeke fuse part number 058597 is rated for Ignition Protection under SAE J1171 as is required for gasoline engine installations. Westerbeke does not recommend using fuses that do not have this certification.